

Confidential

TECHNICAL SERVICE BULLETIN

NO.

2 D 40



DATE: 8/28/69

BRITISH LEYLAND MOTORS INC.
600 Willow Tree Road • Leonia • New Jersey 07605

SUBJECT:

Oil Leakage From Kickdown Housing

MODELS:

Austin America
Automatics

To reduce breakages caused by distortion of the flange due to overtightening of the retaining bolts, a larger and thicker flat washer, Part #PWZ 204, is to be used under the kickdown housing retaining bolts.

The opportunity should be taken of fitting this washer whenever transmissions are removed from vehicles.

The retaining bolts must not be retightened in excess of 5 lbs./ft.