

600 Willow Tree Road • Leonia • New Jersey 07605

NO. 2 F 34

C13/69

DATE: _____12/1/69

SUBJECT: MODELS:

REAR HUB OIL LEAKS

MGB & MGC

To reduce the risk of the oil seal lip being damaged during fitting it is important that the oil seal collar AAA982 be fitted after the oil seal housing BTB682.

To prevent oil leakage between the faces of the axle case and the seal housing a bead of jointing compound should be applied to the face of the housing before assembling.

If the oil seal housing is removed for any reason, the seal should be discarded and replaced by a new one.

It must be stressed that an overfilled axle case aggravates this complaint and you are reminded that the oil level should be checked on the pre-delivery inspection.