

TECHNICAL SERVICE BULLETIN

NO. 72 A 3



April, 1972

SUBJECT:


'O' Ring Diameter
Choke Unit
S.U. H.I.F. Carburetor

MODELS:

1972 MGB and MGB/GT

Isolated cases have been reported of the wrong size 'O' ring having been fitted to the rotary choke unit body on production. This creates an uncontrollable rich mixture, very uneven running and should be evident almost immediately on new cars.

The correct 'O' ring, part number AUD 3602 with an outside diameter of 9/16" is illustrated below (Item A).

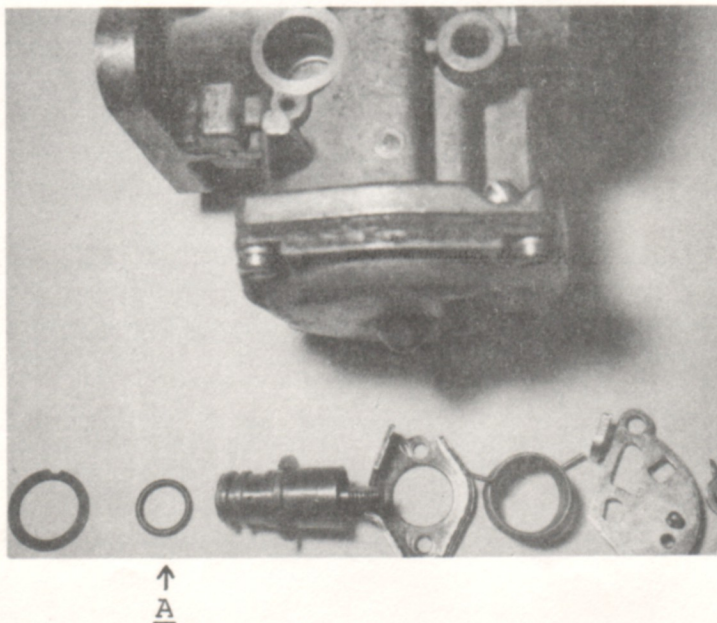

Warranty claims will be accepted for parts plus 1.30 hours shop time, which includes removing both carburetors, removing one choke unit and replacing the 'O' ring.

DJH